



Welcome to [E-XFL.COM](https://www.e-xfl.com)

### What is "[Embedded - Microcontrollers](#)"?

"[Embedded - Microcontrollers](#)" refer to small, integrated circuits designed to perform specific tasks within larger systems. These microcontrollers are essentially compact computers on a single chip, containing a processor core, memory, and programmable input/output peripherals. They are called "embedded" because they are embedded within electronic devices to control various functions, rather than serving as standalone computers. Microcontrollers are crucial in modern electronics, providing the intelligence and control needed for a wide range of applications.

### Applications of "[Embedded - Microcontrollers](#)"

#### Details

Product Status	Obsolete
Core Processor	PIC
Core Size	16-Bit
Speed	16 MIPS
Connectivity	I <sup>2</sup> C, IrDA, LINbus, SPI, UART/USART
Peripherals	Brown-out Detect/Reset, Motor Control PWM, POR, PWM, WDT
Number of I/O	35
Program Memory Size	32KB (11K x 24)
Program Memory Type	FLASH
EEPROM Size	-
RAM Size	1K x 16
Voltage - Supply (Vcc/Vdd)	3V ~ 3.6V
Data Converters	A/D 14x10b
Oscillator Type	Internal
Operating Temperature	-40°C ~ 125°C (TA)
Mounting Type	Surface Mount
Package / Case	44-VFTLA Exposed Pad
Supplier Device Package	44-VTLA (6x6)
Purchase URL	<a href="https://www.e-xfl.com/product-detail/microchip-technology/pic24fj32mc104t-e-tl">https://www.e-xfl.com/product-detail/microchip-technology/pic24fj32mc104t-e-tl</a>

# PIC24FJ32MC104 FAMILY

## PIC24FJ32MC104 Family Silicon Errata and Data Sheet Clarification

The PIC24FJ32MC104 family devices that you have received conform functionally to the current Device Data Sheet (DS39997C), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in Table 1. The silicon issues are summarized in Table 2.

The errata described in this document will be addressed in future revisions of the PIC24FJ32MC104 family silicon.

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of Table 2 apply to the current silicon revision (A0).

Data Sheet clarifications and corrections start on Page 5, following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip's programmers, debuggers and emulation tools, which are available at the Microchip corporate web site ([www.microchip.com](http://www.microchip.com)).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with MPLAB ICD 3 or PICKIT™ 3:

1. Using the appropriate interface, connect the device to the MPLAB ICD 3 programmer/debugger or PICKIT 3.
2. From the main menu in MPLAB IDE, select Configure>Select Device, and then select the target part number in the dialog box.
3. Select the MPLAB hardware tool (Debugger>Select Tool).
4. Perform a "Connect" operation to the device (Debugger>Connect). Depending on the development tool used, the part number *and* Device Revision ID value appear in the **Output** window.

**Note:** If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The Device and Revision ID values for the various PIC24FJ32MC104 family silicon revisions are shown in Table 1.

**TABLE 1: SILICON DEVREV VALUES**

Part Number	Device ID <sup>(1)</sup>	Revision ID for Silicon Revision <sup>(2)</sup>
		A0
PIC24FJ32MC101	0x0A0C	0x3000
PIC24FJ32MC102	0x0A0D	
PIC24FJ32MC104	0x0A0F	

**Note 1:** The Device and Revision IDs (DEVID and DEVREV) are located at the last two implemented addresses in program memory.

- 2:** Refer to the "PIC24FJXXMC Family Flash Programming Specification" (DS75012) for detailed information on Device and Revision IDs for your specific device.

# PIC24FJ32MC104 FAMILY

**TABLE 2: SILICON ISSUE SUMMARY**

Module	Feature	Item Number	Issue Summary	Affected Revisions <sup>(1)</sup>
				A0
SPI	Frame Sync Pulse	1.	Frame sync pulse is not generated in Master mode when FRMPOL = 0.	X
SPI	Frame Sync Pulse	2.	When in SPI Slave mode, with the frame sync pulse set as an input, FRMDLY must be set to '0'.	X
UART	TX Interrupt	3.	A TX interrupt may occur before the data transmission is complete.	X
UART	UARTEN	4.	The Transmitter Write Pointer does not clear when the UART is disabled (UARTEN = 0); it requires UTXEN to be set in order to clear the Write Pointer.	X
CPU	div.sd Instruction	5.	When using the div.sd instruction, the overflow bit is not getting set when an overflow occurs.	X
CPU	Interrupt Disable	6.	When a previous DISI instruction is active (i.e., the DISICNT register is non-zero), and the value of the DISICNT register is updated manually, the DISICNT register Freezes and disables interrupts permanently.	X
Oscillator	Clock Switching	7.	Clock switch does not abort when device enters Sleep mode.	X

**Note 1:** Only those issues indicated in the last column apply to the current silicon revision.

## Silicon Errata Issues

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (**A0**).

### 1. Module: SPI

When using the frame sync pulse output feature (FRMEN bit (SPIxCON2<15>) = 1) in Master mode (SPIFSD bit (SPIxCON2<14>) = 0), the frame sync pulse is not being generated with an active-low pulse (FRMPOL (SPIxCON2<13>) = 0).

#### Work around

The Slave Select pin is used as the frame sync pulse when the frame sync pulse output feature is used. Mapping the SSx input function and output function to the same pad, using the PPS feature, resolves this issue.

The code in Example 1 assigns SPI1 Slave Select input and SPI1 Slave Select output to RP15.

#### EXAMPLE 1:

```
/* Assign SPI1 Slave Select Input to RP15 */
RPINR21bits.SS1R = 15;

/* Assign peripheral output function SPI1
to RP15 */
RPOR7bits.RP15R = 0b01001;
```

#### Affected Silicon Revisions

A0							
X							

### 2. Module: SPI

When in SPI Slave mode (MSTEN bit (SPIxCON1<5>) = 0) and using the frame sync pulse output feature (FRMEN bit (SPIxCON2<15>) = 1 and SPIFSD bit (SPIxCON2<14>) = 0), the Frame Sync Pulse Edge Select bit must be set to '0' (FRMDLY bit (SPIxCON2 <1>) = 0).

#### Work around

There is no work around. The Frame Sync Pulse Edge Select (FRMDLY) bit cannot be set to produce a Frame sync pulse that coincides with the first bit clock.

#### Affected Silicon Revisions

A0							
X							

### 3. Module: UART

When using UTXISEL<1:0> = 01 (interrupt when last character is shifted out of the Transmit Shift Register), and the final character is being shifted out through the Transmit Shift Register (TSR), the TX interrupt may occur before the final bit is shifted out.

#### Work around

If it is critical that the interrupt processing occurs only when all transmit operations are complete, after which, the following work around can be implemented:

Hold off the interrupt routine processing by adding a loop at the beginning of the routine that polls the Transmit Shift Register empty bit, as shown in Example 2.

#### EXAMPLE 2:

```
// in UART1 initialization code
...
// Set to generate TX interrupt when all
// transmit operations are complete.
U1STAbits.UTXISEL0 = 1;
U1STAbits.UTXISEL1 = 0;
...

U1TXInterrupt(void)
{
    // wait for the transmit buffer to be
    // empty and then process interrupt.
    while (U1STAbits.TRMT==0);
    ...
}
```

#### Affected Silicon Revisions

A0							
X							

### 4. Module: UART

The Transmitter Write Pointer does not get cleared when the UART module is disabled (UARTEN = 0) and it requires the UTXEN bit to be set in order to clear the Write Pointer.

#### Work around

Do not load data into the TX FIFO (register) before setting the UTXEN bit.

#### Affected Silicon Revisions

A0							
X							

# PIC24FJ32MC104 FAMILY

---

## 5. Module: CPU

When using the Signed 32 by 16-bit Division instruction, `div.sd`, the overflow bit does not always get set when an overflow occurs.

### Work around

Test for and handle overflow conditions outside of the `div.sd` instruction.

### Affected Silicon Revisions

A0							
X							

## 6. Module: CPU

When a previous `DISI` instruction is active (i.e., the `DISCNT` register is non-zero), and the value of the `DISCNT` register is updated manually, the `DISCNT` register Freezes and disables interrupts permanently.

### Work around

Avoid updating the `DISCNT` register manually. Instead, use the `DISI #n` instruction with the required value for 'n'.

### Affected Silicon Revisions

A0							
X							

## 7. Module: Oscillator

Clock switch requests are not aborted if the device enters Sleep mode during the execution of the clock switch.

### Work around

None.

### Affected Silicon Revisions

A0							
X							

## Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS39997C):

<b>Note:</b> Corrections are shown in <b>bold</b> . Where possible, the original bold text formatting has been removed for clarity.
---

None to report at this time.

## APPENDIX A: REVISION HISTORY

### Rev A Document (8/2012)

Initial release of this document, issued for Revision A0 silicon. Includes silicon issues 1 and 2 (SPI), 3 and 4 (UART), 5 and 6 (CPU), and 7 (Oscillator).

---

**Note the following details of the code protection feature on Microchip devices:**

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

---

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

#### **Trademarks**

The Microchip name and logo, the Microchip logo, dsPIC, KEELOQ, KEELOQ logo, MPLAB, PIC, PICmicro, PICSTART, PIC<sup>32</sup> logo, rfPIC and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

FilterLab, Hampshire, HI-TECH C, Linear Active Thermistor, MXDEV, MXLAB, SEEVAL and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, BodyCom, chipKIT, chipKIT logo, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, dsSPEAK, ECAN, ECONOMONITOR, FanSense, HI-TIDE, In-Circuit Serial Programming, ICSP, Mindi, MiWi, MPASM, MPLAB Certified logo, MPLIB, MPLINK, mTouch, Omniscent Code Generation, PICC, PICC-18, PICDEM, PICDEM.net, PICKIT, PICtail, REAL ICE, rLAB, Select Mode, Total Endurance, TSHARC, UniWinDriver, WiperLock and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2012, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

Printed on recycled paper.

ISBN: 978-1-62076-516-6

**QUALITY MANAGEMENT SYSTEM**  
**CERTIFIED BY DNV**  
**== ISO/TS 16949 ==**

*Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.*



---

---

## Worldwide Sales and Service

---

---

### AMERICAS

#### Corporate Office

2355 West Chandler Blvd.  
Chandler, AZ 85224-6199  
Tel: 480-792-7200  
Fax: 480-792-7277  
Technical Support:  
<http://www.microchip.com/support>  
Web Address:  
[www.microchip.com](http://www.microchip.com)

#### Atlanta

Duluth, GA  
Tel: 678-957-9614  
Fax: 678-957-1455

#### Boston

Westborough, MA  
Tel: 774-760-0087  
Fax: 774-760-0088

#### Chicago

Itasca, IL  
Tel: 630-285-0071  
Fax: 630-285-0075

#### Cleveland

Independence, OH  
Tel: 216-447-0464  
Fax: 216-447-0643

#### Dallas

Addison, TX  
Tel: 972-818-7423  
Fax: 972-818-2924

#### Detroit

Farmington Hills, MI  
Tel: 248-538-2250  
Fax: 248-538-2260

#### Indianapolis

Noblesville, IN  
Tel: 317-773-8323  
Fax: 317-773-5453

#### Los Angeles

Mission Viejo, CA  
Tel: 949-462-9523  
Fax: 949-462-9608

#### Santa Clara

Santa Clara, CA  
Tel: 408-961-6444  
Fax: 408-961-6445

#### Toronto

Mississauga, Ontario,  
Canada  
Tel: 905-673-0699  
Fax: 905-673-6509

### ASIA/PACIFIC

#### Asia Pacific Office

Suites 3707-14, 37th Floor  
Tower 6, The Gateway  
Harbour City, Kowloon  
Hong Kong  
Tel: 852-2401-1200  
Fax: 852-2401-3431

#### Australia - Sydney

Tel: 61-2-9868-6733  
Fax: 61-2-9868-6755

#### China - Beijing

Tel: 86-10-8569-7000  
Fax: 86-10-8528-2104

#### China - Chengdu

Tel: 86-28-8665-5511  
Fax: 86-28-8665-7889

#### China - Chongqing

Tel: 86-23-8980-9588  
Fax: 86-23-8980-9500

#### China - Hangzhou

Tel: 86-571-2819-3187  
Fax: 86-571-2819-3189

#### China - Hong Kong SAR

Tel: 852-2401-1200  
Fax: 852-2401-3431

#### China - Nanjing

Tel: 86-25-8473-2460  
Fax: 86-25-8473-2470

#### China - Qingdao

Tel: 86-532-8502-7355  
Fax: 86-532-8502-7205

#### China - Shanghai

Tel: 86-21-5407-5533  
Fax: 86-21-5407-5066

#### China - Shenyang

Tel: 86-24-2334-2829  
Fax: 86-24-2334-2393

#### China - Shenzhen

Tel: 86-755-8203-2660  
Fax: 86-755-8203-1760

#### China - Wuhan

Tel: 86-27-5980-5300  
Fax: 86-27-5980-5118

#### China - Xian

Tel: 86-29-8833-7252  
Fax: 86-29-8833-7256

#### China - Xiamen

Tel: 86-592-2388138  
Fax: 86-592-2388130

#### China - Zhuhai

Tel: 86-756-3210040  
Fax: 86-756-3210049

### ASIA/PACIFIC

#### India - Bangalore

Tel: 91-80-3090-4444  
Fax: 91-80-3090-4123

#### India - New Delhi

Tel: 91-11-4160-8631  
Fax: 91-11-4160-8632

#### India - Pune

Tel: 91-20-2566-1512  
Fax: 91-20-2566-1513

#### Japan - Osaka

Tel: 81-66-152-7160  
Fax: 81-66-152-9310

#### Japan - Yokohama

Tel: 81-45-471- 6166  
Fax: 81-45-471-6122

#### Korea - Daegu

Tel: 82-53-744-4301  
Fax: 82-53-744-4302

#### Korea - Seoul

Tel: 82-2-554-7200  
Fax: 82-2-558-5932 or  
82-2-558-5934

#### Malaysia - Kuala Lumpur

Tel: 60-3-6201-9857  
Fax: 60-3-6201-9859

#### Malaysia - Penang

Tel: 60-4-227-8870  
Fax: 60-4-227-4068

#### Philippines - Manila

Tel: 63-2-634-9065  
Fax: 63-2-634-9069

#### Singapore

Tel: 65-6334-8870  
Fax: 65-6334-8850

#### Taiwan - Hsin Chu

Tel: 886-3-5778-366  
Fax: 886-3-5770-955

#### Taiwan - Kaohsiung

Tel: 886-7-536-4818  
Fax: 886-7-330-9305

#### Taiwan - Taipei

Tel: 886-2-2500-6610  
Fax: 886-2-2508-0102

#### Thailand - Bangkok

Tel: 66-2-694-1351  
Fax: 66-2-694-1350

### EUROPE

#### Austria - Wels

Tel: 43-7242-2244-39  
Fax: 43-7242-2244-393

#### Denmark - Copenhagen

Tel: 45-4450-2828  
Fax: 45-4485-2829

#### France - Paris

Tel: 33-1-69-53-63-20  
Fax: 33-1-69-30-90-79

#### Germany - Munich

Tel: 49-89-627-144-0  
Fax: 49-89-627-144-44

#### Italy - Milan

Tel: 39-0331-742611  
Fax: 39-0331-466781

#### Netherlands - Drunen

Tel: 31-416-690399  
Fax: 31-416-690340

#### Spain - Madrid

Tel: 34-91-708-08-90  
Fax: 34-91-708-08-91

#### UK - Wokingham

Tel: 44-118-921-5869  
Fax: 44-118-921-5820

11/29/11